

AD-A130 463

ROTOR FRAGMENT PROTECTION PROGRAM STATISTICS ON
AIRCRAFT GAS TURBINE ENGI.. (U) NAVAL AIR PROPULSION
CENTER TRENTON NJ PROPULSION TECHNOLOGY A..

1/1


UNCLASSIFIED

R A DELUCIA ET AL. OCT 82 NAPC-PE-80

F/G 21/5

NL

END
DATE
FILED
8 83
DTIC

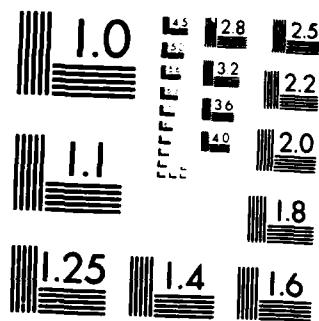

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS 1964 A

(12)

NAVAL AIR PROPULSION CENTER

TRENTON, NEW JERSEY 08628



ADA 131463

NAPC-PE-80
NASA-CR-168163


October 1982

ROTOR FRAGMENT PROTECTION PROGRAM: STATISTICS ON AIRCRAFT
GAS TURBINE ENGINE ROTOR FAILURES THAT OCCURRED IN U. S.
COMMERCIAL AVIATION DURING 1979

By R. A. DeLucia & J. T. Salvino

DTIC FILE COPY

APPROVED FOR PUBLIC
RELEASE: DISTRIBUTION
UNLIMITED

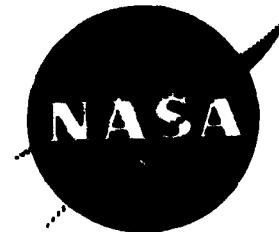

DTIC
SELECTED
S JUL 14 1983
A

83 07 14 029

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER NASA-CR-168163	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) ROTOR FRAGMENT PROTECTION PROGRAM: STATISTICS ON AIRCRAFT GAS TURBINE ENGINE ROTOR FAILURES THAT OCCURRED IN U. S. COMMERCIAL AVIATION DURING 1979		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) R. A. DeLucia and J. T. Salvino		6. PERFORMING ORG. REPORT NUMBER NAPC-PE-80
9. PERFORMING ORGANIZATION NAME AND ADDRESS Commanding Officer Naval Air Propulsion Center (PE42) Trenton, New Jersey 08628		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS None
11. CONTROLLING OFFICE NAME AND ADDRESS National Aeronautics and Space Administration Lewis Research Center Cleveland, Ohio 44135		12. REPORT DATE October 1982
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		13. NUMBER OF PAGES 29
		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) APPROVED FOR PUBLIC RELEASE: DISTRIBUTION UNLIMITED		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report).		
18. SUPPLEMENTARY NOTES "Structures and Mechanical Technologies Division," Lewis Research Center, Cleveland, Ohio 44135, Advisor, C. C. Chamis Other report designation: NASA-CR-168163		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Air Transportation Aircraft Hazards Aircraft Safety Gas Turbine Engine Rotor Failures		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report presents statistical information relating to the number of gas turbine engine rotor failures which occurred during 1979 in commercial aviation service use. The predominant failure mode involved blade fragments, 84 percent of which were contained. No uncontained disk failures occurred and although fewer rotor rim and seal failures occurred, 100 percent and 50 percent, respectively, were uncontained. Sixty-eight percent of the 157 rotor failures occurred during the take-off and climb stages of flight.		

NAVAL AIR PROPULSION CENTER
TRENTON, NEW JERSEY 08628

PROPULSION TECHNOLOGY AND PROJECT ENGINEERING DEPARTMENT

NAPC-PE-80
NASA-CR-168163

OCTOBER 1982

ROTOR FRAGMENT PROTECTION PROGRAM: STATISTICS ON AIRCRAFT
GAS TURBINE ENGINE ROTOR FAILURES THAT OCCURRED IN U. S.
COMMERCIAL AVIATION DURING 1979

Prepared by: Robert A. Deluca
ROBERT A. DELUGA
James T. Salvino
JAMES T. SALVINO

Typed by: MAUREEN SCHULER

Reviewed and Approved: OCTOBER 1982

T. E. Elsasser
T. E. ELSASSER

APPROVED FOR PUBLIC RELEASE:
DISTRIBUTION UNLIMITED

Authorization: NASA DPR C-41581-B, MOD. 10

ACKNOWLEDGEMENTS

We thank the Flight Standards National Field Office, Federal Aviation Administration, Oklahoma City, Oklahoma, for their cooperative effort in providing the basic data used for this report.

Accession For	
100- GRA&I	<input checked="" type="checkbox"/>
100- TAB	<input type="checkbox"/>
Unnumbered	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Local And/or	
Dist	Special



TABLE OF CONTENTS

	<u>Page</u>
REPORT DOCUMENTATION PAGE -- DD Form 1473	
TITLE PAGE	
ACKNOWLEDGEMENTS	i
TABLE OF CONTENTS	ii
LIST OF FIGURES	iii
INTRODUCTION	1
RESULTS	1-3
CONCLUSIONS	3
Figures 1 through 7	4-10
APPENDIX A	A1-A13
DISTRIBUTION LIST	Inside rear cover

LIST OF FIGURES

<u>Figure No.</u>	<u>Title</u>	<u>Page</u>
1	Incidence of Rotor Failure in U. S. Commercial Aviation - 1979	4
2	Component and Fragment Type Distribution for Contained and Uncontained Rotor Failures - 1979	5
3	The Incidence of Rotor Failure in U. S. Commercial Aviation According to Engine Type Affected - 1979	6
4	Rotor Failure Cause Categories - 1979	7
5	Flight Condition at Rotor Failure - 1979	8
6	Uncontained Rotor Failure Distributions According to Cause and Flight Condition - 1976 - 1979	9
7	The Incidence of Uncontained Rotor Failure in U. S. Commercial Aviation - 1962 - 1979	10

INTRODUCTION

This report has been prepared as part of the Rotor Fragment Protection Program (RFPP), which is sponsored by the National Aeronautics and Space Administration (NASA)¹ and conducted by the Naval Air Propulsion Center (NAPC). The objective of the RFPP is to develop criteria for the design of devices that will be used on aircraft to protect occupants and the aircraft structure from the potentially lethal and devastating fragments that are generated by gas turbine engine rotor failures.

Presented in this report are statistics on gas turbine rotor failures that have occurred in U. S. commercial aviation during 1979. These statistics are based on data compiled from the Flight Standards Service Difficulty Reports (SDRs) that were published by the Department of Transportation, Federal Aviation Administration (FAA). The compiled data were analyzed to establish:

1. The incidence of rotor failures and the incidence of contained and uncontained² rotor fragments.

2. The distribution of rotor failures with respect to engine rotor component; i.e., fan, compressor or turbine rotors and their rotating attachments or appendages such as spacers and seals.

3. The type of rotor fragment (disk, rim or blade) typically generated at failure.

4. The cause of failure.

5. The type of engines involved.

6. The flight condition at the time of failure.

RESULTS

1. The data used for analysis are contained in APPENDIX A. The results of these analyses are shown in Figures 1 through 7.

a. Figure 1 shows that 157 rotor failures occurred in 1979. These rotor failures accounted for approximately 7.4% of the 2124 shutdowns experienced by the gas turbine powered U. S. commercial aircraft fleet during 1979.

¹NASA DPR C-41581-B, Mod. 8.

²An uncontained rotor failure is defined as a rotor failure that produces fragments which penetrate and escape the confines of the engine casing.

Rotor fragments were generated in 98 of the failures experienced and, of these, 18 (18.4% of the fragment producing failures) were uncontained. This represents an uncontained failure rate of 2.5 per million gas turbine engine powered aircraft flight hours, or 1.2 per million engine operation hours. Approximately 7.3 million and 21.5 million aircraft flight and engine operating hours, respectively, were logged by the U.S. commercial aviation fleet in 1979.

b. Figure 2 shows the distribution of rotor failures that produced fragments according to the engine component involved — fan, compressor, turbine; the types of fragments that were generated; and the percentage of uncontained failures according to the type fragment generated. These data indicate that:

(1) The incidence of turbine-rotor-fragment-producing failures was approximately 2.4 times greater than that of compressor-rotor-fragment-producing failures; these corresponded to 62.2% and 26.5%, respectively, of the total number of rotor failures. Fan rotor failures accounted for 11.2% of the fragment producing failures experienced.

(2) Blade fragments were generated in 96.0% of the rotor failures; 15.9% of these were uncontained. The remaining rotor fragment failures (4.0%) produced rim and seal fragments, of which 100% and 50%, respectively, were uncontained.

c. Figure 3 shows the rotor failure distribution among the types of engines that were affected, and the total number of that type engine in use.

d. Figure 4 shows what caused the rotor failures to occur. Of the known causes of failure⁽¹⁾, the dominant causal factors were: (1) Foreign Object Damage (FOD) (36.8%); (2) Secondary causes (35.8%), and (3) Design and Life Prediction Problems (21.1%).

e. Figure 5 indicates the flight conditions that existed when the various rotor failures occurred. Approximately 68% of the 157 rotor failures occurred during takeoff and climb stages of flight. Approximately 69% of the rotor fragment producing failures, and 78% of the uncontained rotor failures, occurred during these same stages of flight. The highest percentage of uncontained rotor failures were experienced during takeoff (39%), and climb (39%). One uncontained failure was not included in the compilation because the cause and flight condition are unknown.

f. Figure 6 is a cumulative tabulation that describes the distribution of uncontained rotor failures according to fragment type, engine component involved, cause category and flight condition⁽²⁾ for the years 1976 to 1979. This figure

(1) Because of the high percentage of unknown causes of rotor failure, the percentages were based on the total number of known causes.

(2) Takeoff and climb are defined as "High Power", all other conditions are defined as "Low Power".

is expanded yearly to include all subsequent uncontained rotor failures. These data indicate that: for "design and life prediction problems" the numbers of uncontained failures were approximately two times greater at "high" power than "low" power (namely 13 and 5); but for all other causes, the prevailing condition was "high power". Additional conclusions should become evident from this table with the accumulation of future data. One uncontained failure that occurred in 1979 was not included in the compilation because the failure cause and flight condition are unknown.

g. Figure 7 shows the annual incidence of uncontained rotor failures in commercial aviation for the years 1962 through 1979. During 1979, the incidence of uncontained rotor failure decreased by one over the previous year, 1978. Over the past five years, 1975 through 1979, an average of 16.4 uncontained rotor failures per year have occurred. During this same time period, the rate of uncontained rotor failures has remained relatively constant at an average of approximately one per million engine operating hours.

CONCLUSIONS

1. The incidence of rotor failure and uncontained failure is significantly high enough to warrant continuation of the experimental and analytical efforts that constitute the RFPP.
2. Of all types of fragments generated at rotor failure, disk and fan blade fragments, because of their size and high energy content, continue to be the threat that must be addressed in the RFPP.
3. It appears that causes such as FOD, structural life and integrity prediction, and secondary effects, are primarily responsible for most of the rotor failures that occur. Progress in the ability to predict structural life is being made through numerous programs sponsored both by Government agencies and by industry. The capability to reduce the causes of failures from secondary effects, such as bearing or seal failures, also is being addressed through technological programs. However, causes due to FOD still appear to be beyond the control or scope of present technology.

INCIDENCE OF ROTOR FAILURE IN U.S. COMMERCIAL AVIATION 1979

NAPC-PE-80

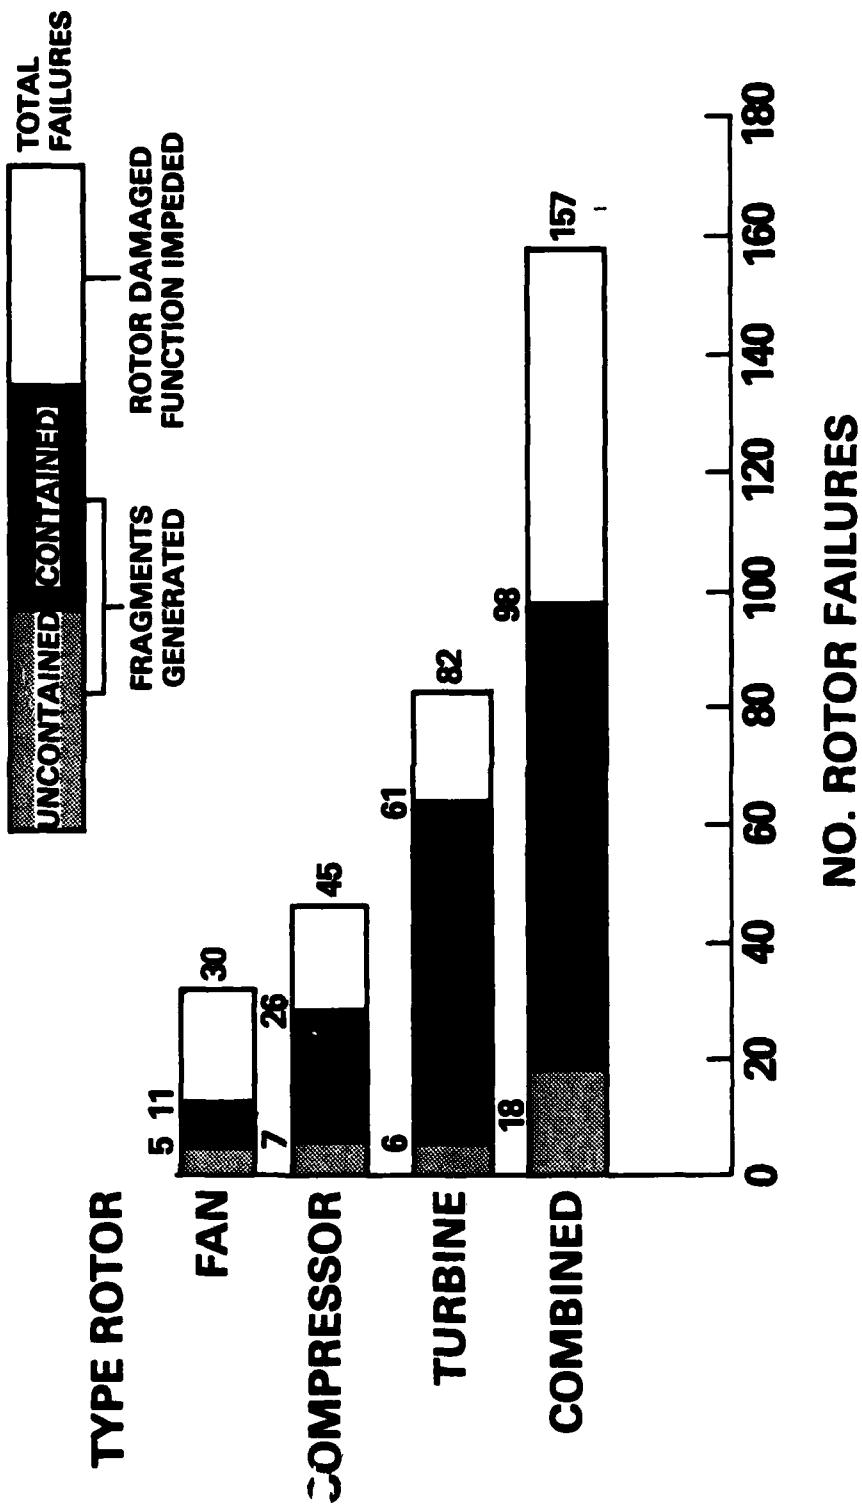


FIGURE 1

COMPONENT AND FRAGMENT TYPE DISTRIBUTIONS FOR CONTAINED AND UNCONTAINED ROTOR FAILURES⁽¹⁾ – 1979


NAPC-PE-80

ENGINE ROTOR COMPONENT	TYPE OF FRAGMENT GENERATED						TOTALS		
	DISK	RIM	BLADE	SEAL	TF	UCF	DISK	RIM	BLADE
FAN	0	0	0	0	11	5	0	0	11
COMPRESSOR	0	0	2	2	22	4	2	1	26
TURBINE	0	0	0	0	61	6	0	0	61
TOTALS	0	0	2	2	94	16	2	1	98


⁽¹⁾ FAILURES THAT PRODUCED FRAGMENTS

TF – TOTAL FAILURES

UCF – UNCONTAINED FAILURES

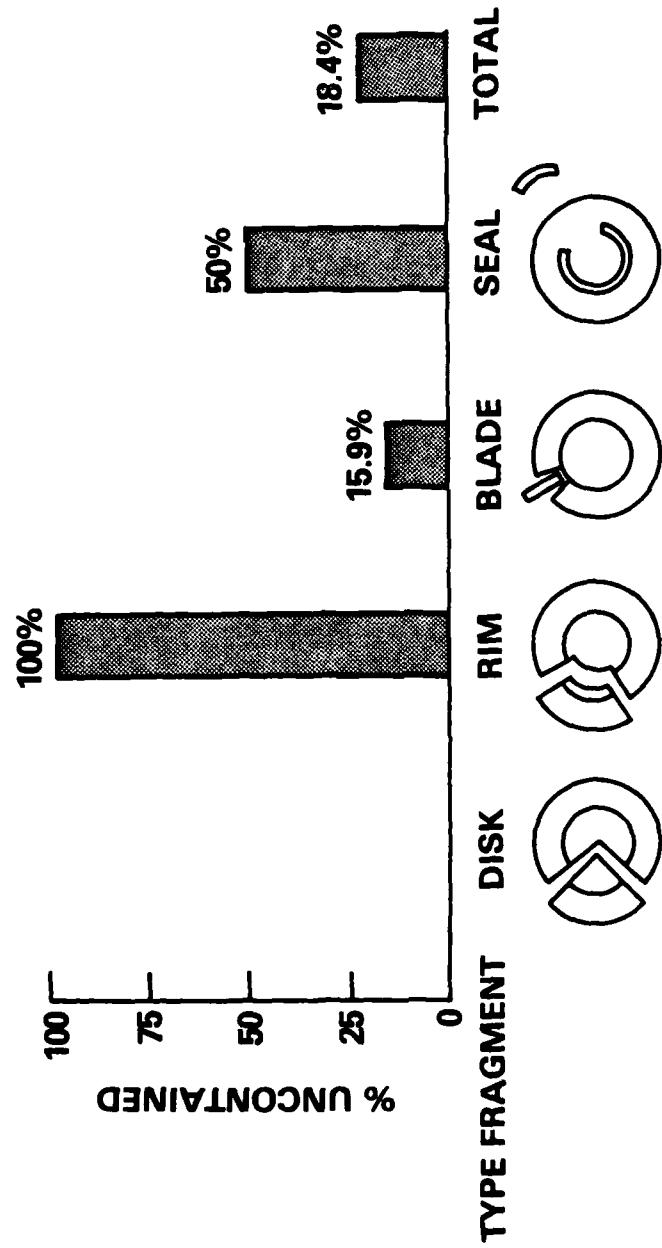


THE INCIDENCE OF ROTOR FAILURE⁽¹⁾ IN U.S. COMMERCIAL AVIATION ACCORDING TO ENGINE TYPE AFFECTED – 1979

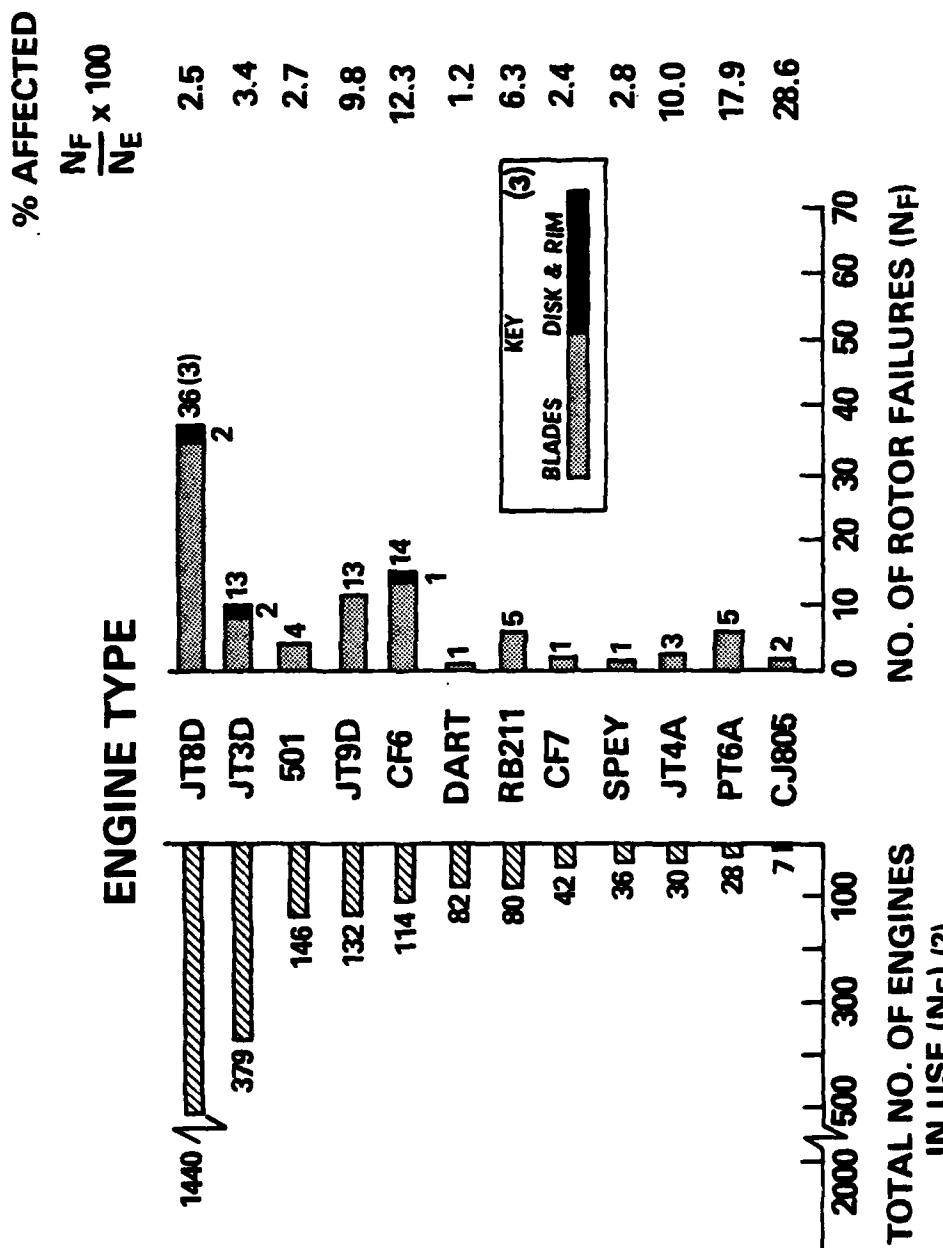

NOTES: (1) FAILURES THAT PRODUCED FRAGMENTS
 (2) YEARLY AVG. OF AIRCRAFT IN USE AT END OF EACH MONTH
 (3) 2 SEAL/SPACER FAILURES INCLUDED IN DISK/RIM COMPILATION

ROTOR FAILURE CAUSE CATEGORIES — 1979

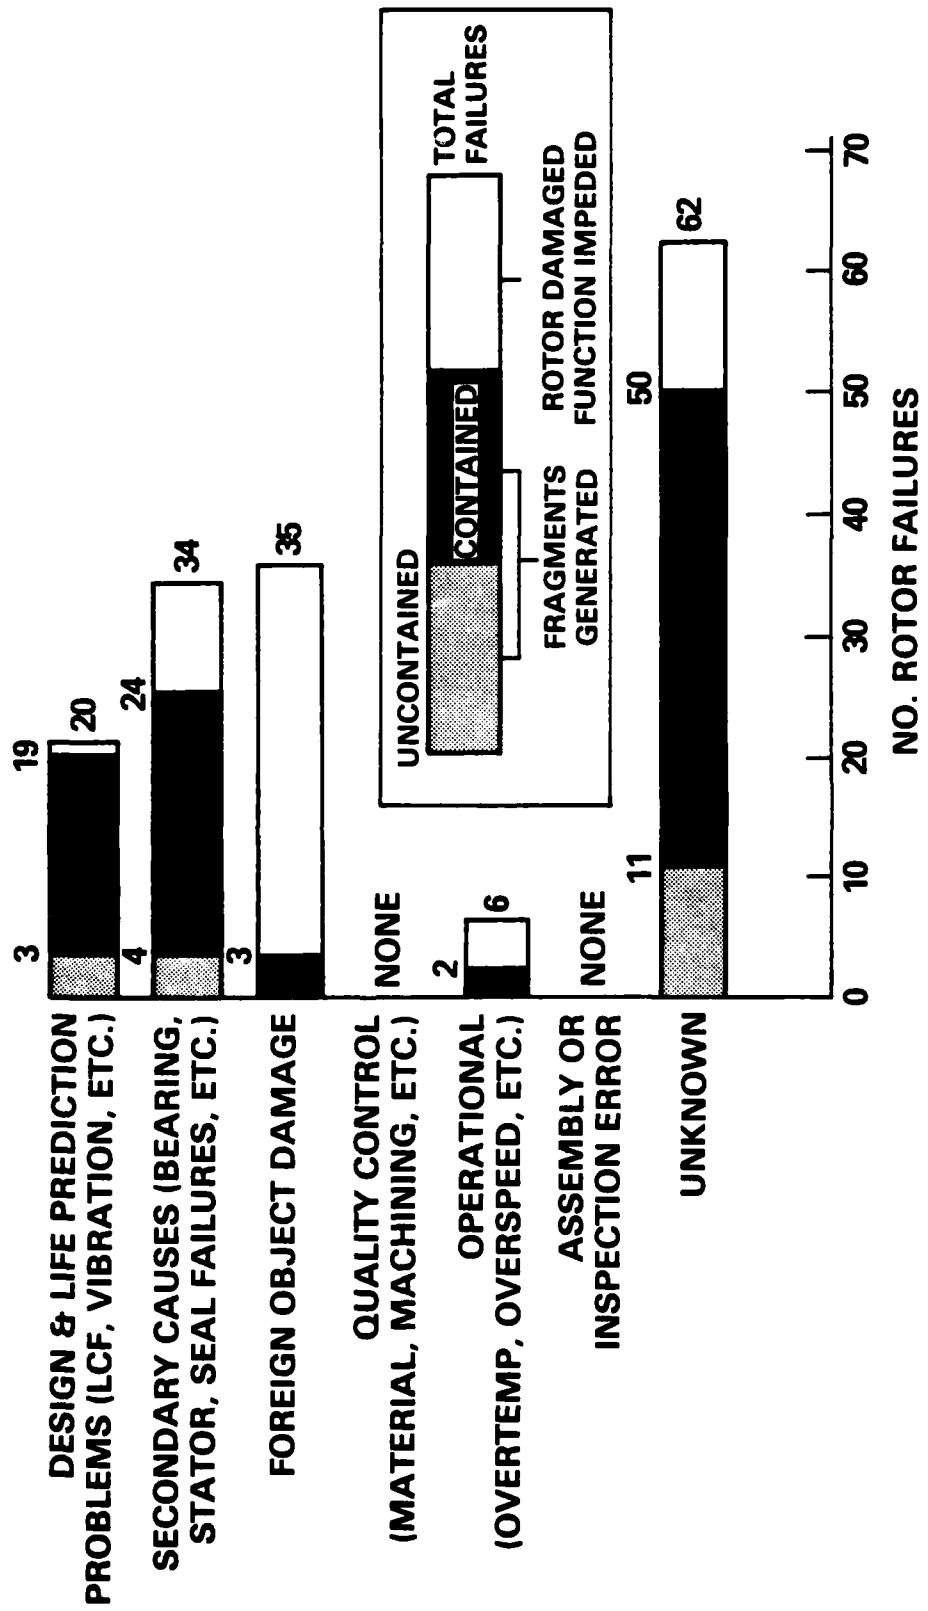

FLIGHT CONDITION AT ROTOR FAILURE - 1978

NAPC-PE-80

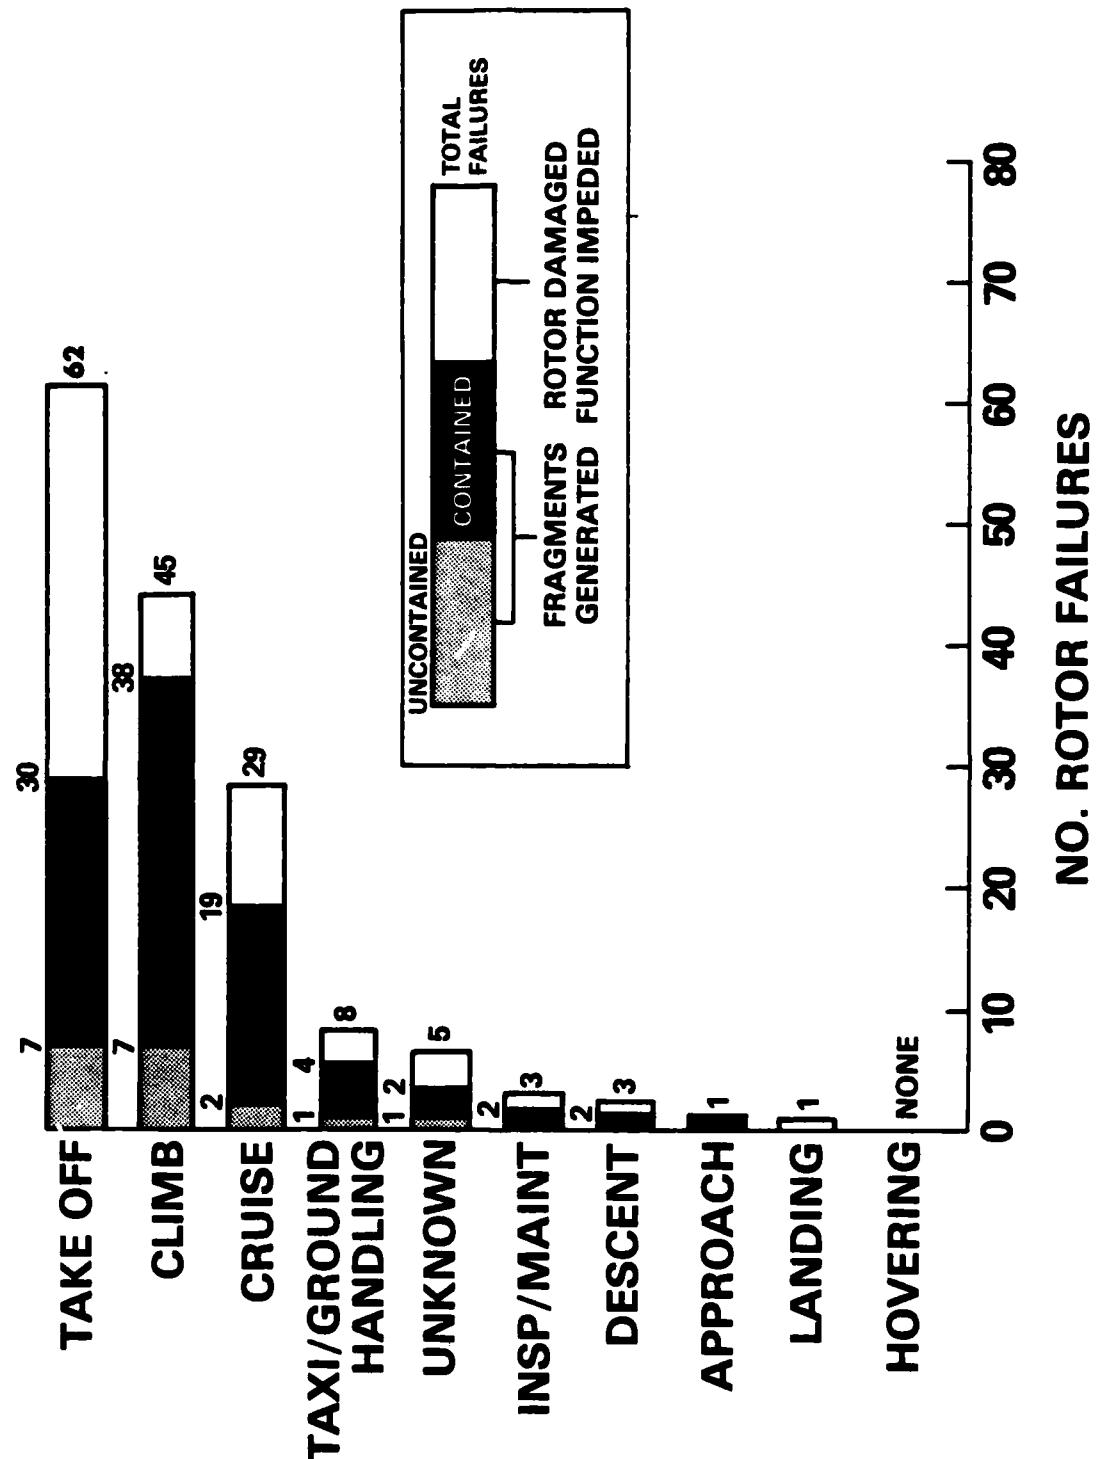


FIGURE 5


**UNCONTAINED ROTOR FAILURE
DISTRIBUTIONS ACCORDING TO CAUSE AND
FLIGHT CONDITION⁽¹⁾ 1976 – 1979**

TYPE OF FRAGMENT GENERATED	DESIGN & LIFE PROB. PROBLEMS		SECONDARY CAUSES		FOREIGN OBJECT DAMAGE		QUALITY CONTROL		UNKNOWN		SUBTOTALS	
	HIGH POWER	LOW POWER	HIGH POWER	LOW POWER	HIGH POWER	LOW POWER	HIGH POWER	LOW POWER	HIGH POWER	LOW POWER	TOTALS	
DISK												
FAN												
COMPRESSOR	1											
TURBINE		2										
RIM												
FAN												
COMPRESSOR	2											
TURBINE												
FAN												
BLADE												
COMPRESSOR	5		2									
TURBINE	1	2	10	2								
FAN												
SEAL												
COMPRESSOR	1											
TURBINE		2										
SUBTOTALS	13	5	16	2	4	1	3	0	18	5	54	13
TOTALS		18		18		5		3	23		67	67

⁽¹⁾ TAKEOFF AND CLIMB ARE DEFINED AS "HIGH POWER," AND ALL OTHER CONDITIONS ARE DEFINED AS "LOW POWER."

**THE INCIDENCE OF UNCONTAINED ROTOR
FAILURES IN U.S. COMMERCIAL AVIATION**
1962 – 1979

NAPC-PE-80

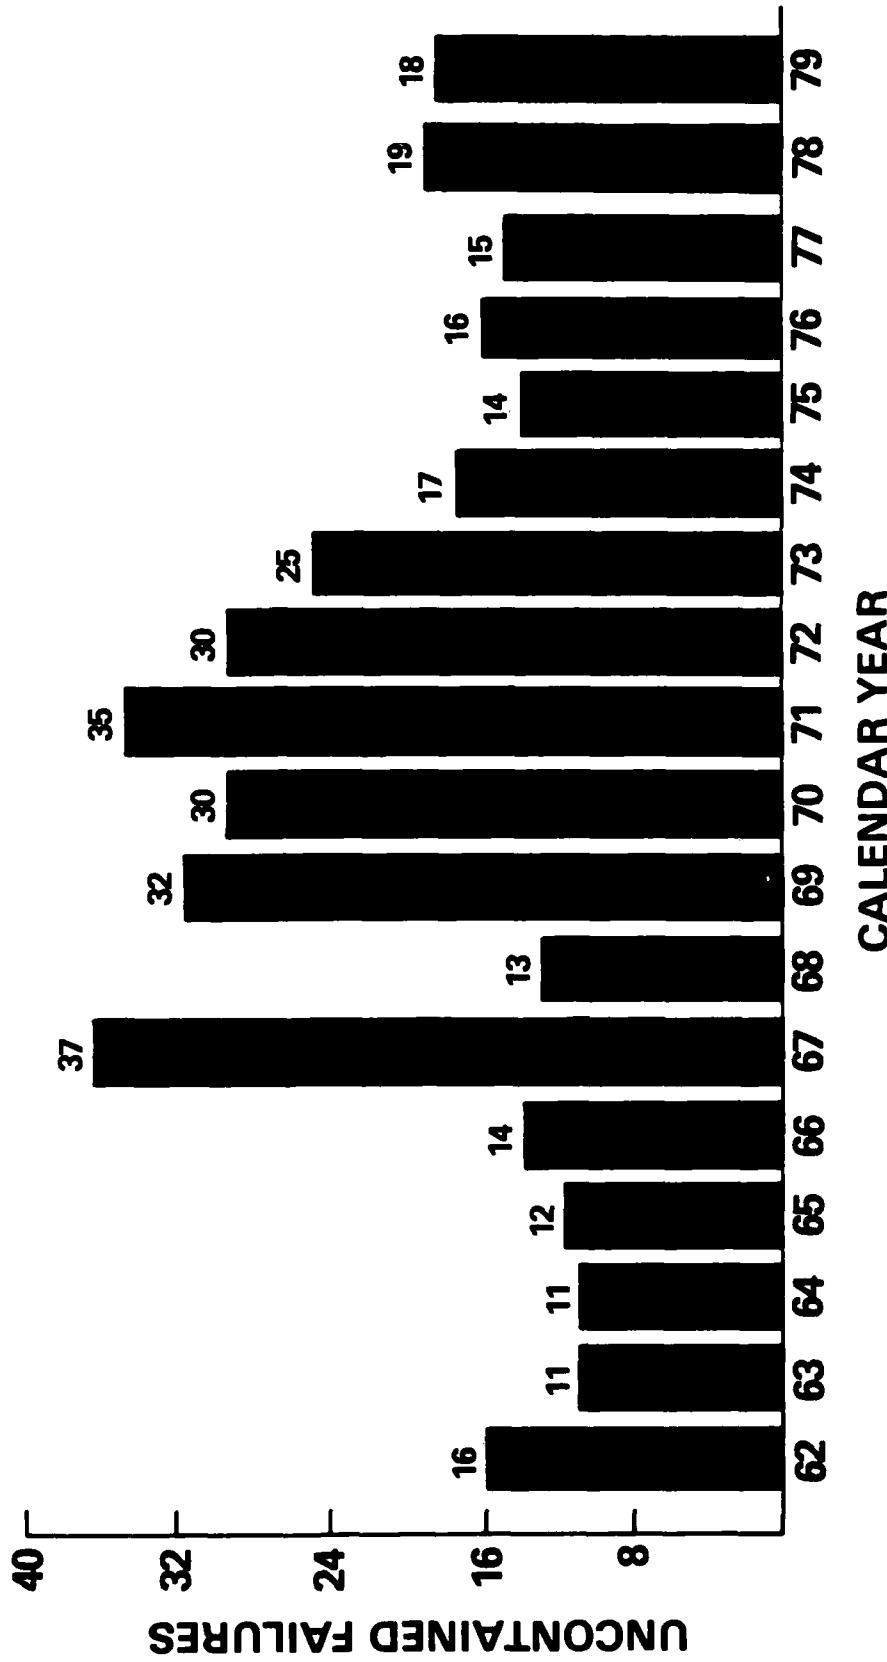

NAPC-PE-80

APPENDIX A

**Data on Rotor Failures in U. S. Commercial
Aviation for 1979. Compiled from the
Federal Aviation Administration Service
Difficulty Reports.**

DATA COMPILATION KEY:

Component Code:

F - Fan

C - Compressor

T - Turbine

Fragment Type Code:

D - Disk

R - Rim

B - Blade

S - Seal

N - None

Cause Code:

1 - Design and Life Prediction Problems

2 - Secondary Causes

3 - Foreign Object Damage

4 - Quality Control

5 - Operational

6 - Assembly or Inspection Error

7 - Unknown

Containment Condition Code:

C - Contained

U - Not Contained

N - No Fragments Generated

Flight Condition Code:

1 - Insp/Maint

2 - Taxi/Grnd Hdl

3 - Takeoff

4 - Climb

5 - Cruise

6 - Descent

7 - Approach

8 - Landing

9 - Hovering

10 - Unknown

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>FRAGMENT</u>	<u>CAUSE</u>	<u>CONTAINMENT</u>	<u>FLIGHT</u>
						<u>TYPE</u>	<u>TYPE</u>	<u>CONDITION</u>	<u>CONDITION</u>
01239027	1/4	OZA	FH227	DART	T	B	1	C	2
01319023	1/7	AAA	DC9	JT8D	T	B	7	C	3
02129032	1/18	EIAS	DC9	JT8D	C	B	1	C	5
02279034	2/4	AAL	DC10	CF6	T	B	7	C	4
03029031	3/2	CAPS	DC8	JT4	T	B	7	C	5
03059030	2/7	NAL	B727	JT8D	F	B	1	C	5
03069026	2/8	AAL	B707	JT3D	F	B	7	U	3
03069027	2/7	OZA	DC9	JT8D	C	B	2	C	3
03079029	2/3	AAA	DC9	JT8D	T	B	7	C	3
03079030	2/1	EAL	DC9	JT8D	C	B	2	C	3
03089033	2/2	AAA	DC9	JT8D	T	B	1	C	4
03099032	2/13	NAL	B727	JT8D	F	B	1	C	3
03149030	2/8	EIAS	DC9	JT8D	T	B	7	C	4
03159024	2/20	SFSX	CV580	501	T	B	1	C	5
03159033	2/11	UAL	B747	JT9D	F	B	2	U	4
03169028	2/17	OZA	DC9	JT8D	T	B	1	C	4

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>FRAGMENT</u> <u>TYPE</u>	<u>CAUSE</u>	<u>CONTAINMENT</u> <u>CONDITION</u>	<u>FLIGHT</u> <u>CONDITION</u>
03199024	2/14	BNF	B727	JT8D	T	B	2	C	10
03199025	2/24	TXI	DC9	JT8D	T	B	7	C	3
03229013	2/28	OZA	DC9	JT8D	C	B	2	C	2
03289024	3/5	CAPS	DC8	JT3D	T	B	1	C	4
04029030	3/7	EAL	DC9	JT8D	C	B	2	C	5
04039030	3/15	TIAS	DC10	CF6	C	R	7	U	3
04059029	3/17	TWA	B707	JT3D	C	B	2	C	3
04059030	2/27	DAL	DC9	JT8D	C	S	7	C	4
04059031	3/3	DAL	DC9	JT8D	T	B	7	U	5
04059033	3/17	TWA	L1011	RB211	T	B	7	C	5
04069031	3/11	CAPS	DC8	JT3D	T	B	7	C	7
04099036	2/7	FECZ	MD20	CF700	F	B	7	C	3
04109035	3/20	TWA	L1011	RB211	C	B	2	C	5
04129037	3/25	TWA	L1011	RB211	C	B	2	C	5
04169040	3/13	AAA	BA111	SPEY	T	B	7	C	4
04239034	3/20	EAL	B727	JT8D	T	B	5	C	3
04249016	4/24	RDLS	DC8	JT3D	T	B	7	C	5
04259029	4/4	PCTC	CV990	CJ805	T	B	2	C	4

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>FRAGMENT</u>	<u>TYPE</u>	<u>CAUSE</u>	<u>CONTAINMENT</u>	<u>FLIGHT</u>	<u>CONDITION</u>
04269033	4/7	TWA	B747	JT9D	C	B	1	C			5
04279038	4/10	TIAS	L382	501	C	B	3	C			6
04279040	4/10	SBWS	B747	JT9D	T	B	2	C			3
05039013	4/9	EIAS	DC8	JT3D	T	B	7	C			4
05079024	4/20	BNF	B747	JT8D	T	B	2	C			3
05089027	4/20	TWA	L1011	RB211	T	B	1	C			4
05099017	4/26	PAA	B727	JT9D	T	B	2	C			4
05169023	4/27	SPAT	CV340	501	T	B	2	C			5
05169025	4/15	NOMC	CV990	CJ805	C	B	3	C			6
05179022	4/28	PAA	B707	JT3D	C	R	7	U			2
05309021	5/14	AW	DC9	JT8D	T	B	7	C			5
06019014	5/20	FTLS	DC8	JT3D	C	B	7	C			4
06049022	5/21	SBWS	B747	JT9D	T	B	2	C			4
06069022	5/22	CAL	DC10	CF6	T	B	7	C			3
06189028	5/23	AW	DC9	JT8D	T	B	7	C			4
06139023	5/31	NAL	DC10	CF6	T	B	7	C			4
06199024	6/6	AAL	B727	JT8D	T	B	7	C			4

CHARACTERISTICS OF ROTOR FAILURES - 1979

SDR NO.	DATE	SUBMITTER	AIRCRAFT	ENGINE	COMPONENT	FRAGMENT TYPE	CAUSE	CONTAINMENT CONDITION		FLIGHT CONDITION
								;	C	
06279027	6/14	AAL	B727	JT8D	T	B	2	;	C	4
06299013	6/15	GLAX	B707	JT3D	T	B	5	C	3	
06299017	6/17	TWA	L1011	RB211	C	B	7	C	5	
07029023	6/18	UAL	B747	JT9D	F	B	2	U	4	
07059026	6/13	ZIAZ	DC8	JT3D	T	B	7	C	3	
07069021	3/27	UAL	DC8	JT3D	T	B	7	U	4	
07099016	6/25	PAI	B737	JT8D	F	B	7	U	3	
07109024	6/21	TWA	B727	JT8D	T	B	7	C	4	
07109026	6/20	NWA	B727	JT9D	F	B	7	U	3	
07119023	6/27	EIAS	DC8	JT3D	T	B	7	C	2	
07239022	7/7	TWA	DC9	JT8D	C	B	2	C	4	
07279025	7/14	TWA	B747	JT9D	T	B	7	C	4	
08029020	7/11	RAIX	DC8	JT4A	T	B	2	C	4	
08079028	7/22	UAL	DC10	CF6	T	B	1	C	4	
08149026	7/23	UAL	DC10	CF6	C	B	7	C	4	
08149031	8/2	CAL	B727	JT8D	F	B	1	C	3	
08179032	8/6	TWA	B707	JT3D	C	B	2	C	4	

CHARACTERISTICS OF ROTOR FAILURES - 1979

SDR NO.	DATE	SUBMITTER	AIRCRAFT	ENGINE	COMPONENT	FRAGMENT TYPE	CAUSE	CONTAINMENT CONDITION		FLIGHT CONDITION
								B	1	
08239029	8/7	ACA	B737	JT8D	C	B	1	U	3	3
08249023	8/2	HAL	DC9	JT8D	T	B	2	C	3	3
08279023	8/10	NWA	B747	JT9D	T	B	1	C	4	4
08279024	8/9	NWA	B747	JT9D	T	B	7	C	3	3
08309029	8/15	SPAT	CV580	501	T	B	7	C	4	4
08309030	8/16	RAIZ	DC8	JT4A	T	B	2	C	5	5
08309031	8/13	PAI	B737	JT8D	T	B	7	C	4	4
09189025	9/4	NWA	B727	JT8D	F	B	7	C	3	3
09219031	9/2	TWA	B747	JT9D	C	B	7	U	4	4
09279031	9/8	RAHT	SD330	PT6A	T	B	7	C	1	1
09279034	9/7	RMAT	DHC7	PT6A	T	B	7	C	4	4
09289020	9/9	WAL	DC10	CF6	C	B	7	U	4	4
10039011	9/17	AAL	B727	JT8D	T	B	7	C	4	4
10059033	9/15	CAL	DC10	CF6	C	B	1	U	4	4
10119038	9/25	TIAS	DC10	CF6	C	B	1	C	4	4
10129033	9/15	AAA	B727	JT8D	T	B	7	C	5	5
10179038	9/28	CAL	DC10	CF6	T	B	7	C	4	4
10179039	9/21	GWAT	SHSD3	PT6A	T	B	7	C	1	1

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>FRAGMENT TYPE</u>	<u>CAUSE</u>	<u>CONTAINMENT CONDITION</u>	<u>FLIGHT CONDITION</u>
10199027	10/19	NWA	DC10	JT9D	F	B	3	C	3
10309039	10/7	PAA	B747	JT9D	T	B	7	C	5
11029022	10/5	DAL	DC9	JT8D	T	B	2	U	4
11099031	10/26	SWA	B737	JT8D	T	B	1	C	3
11169026	10/29	CAL	DC10	CF6	T	B	7	C	3
11209027	10/27	EAL	B727	JT8D	C	S	1	U	3
12129036	11/13	ANE	DHC6	PT6A	T	B	2	U	5
12149036	11/29	NAL	DC10	CF6	C	B	7	C	5
01140038	12/22	SWA	B737	JT8D	T	B	1	C	3
01170034	12/20	UAL	DC10	CF6	T	B	7	C	3
01170035	12/21	WAL	DC10	CF6	T	B	7	U	10

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>CAUSE</u>	<u>FLIGHT CONDITION</u>
02129020	2/19	HAL	DC9	JT8D	F	3	3
02209032	1/27	TWA	B727	JT8D	C	3	3
01199027	1/2	TWA	B747	JT9D	C	2	10
03059029	2/9	TWA	B727	JT8D	T	2	4
03069026	2/8	AAL	B707	JT3D	F	3	3
03069028	2/14	NAL	B727	JT8D	F	3	3
03149033	2/17	TWA	B747	JT9D	C	3	5
03159030	2/18	DAL	B727	JT8D	C	3	3
03169027	2/17	AWI	DC9	JT8D	T	7	3
03169032	2/20	TWA	L1011	RB211	C	3	3
03199021	2/23	TIAS	L382	501	C	3	3
03219034	1/15	MNCT	CV600	DART	T	2	2
04029031	3/10	NAL	B727	JT8D	C	3	5
04109034	3/20	TWA	B707	JT4	T	7	3
04179037	3/20	AAA	DC9	JT8D	T	5	2
04259032	4/5	PAI	B737	JT8D	F	3	3
04269030	4/1	PCTC	CV990	CJ805	F	2	5

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>CAUSE</u>	<u>FLIGHT CONDITION</u>
04279039	4/10	ACA	L188	501	T	2	5
05099012	4/26	TIAS	L382	501	T	3	10
05099016	4/22	AAA	B727	JT8D	C	7	3
05169024	4/27	AIAX	L382	501	C	7	5
05179024	5/19	AAA	DC9	JT8D	F	3	3
05259025	5/10	AIAX	L382	501	T	7	10
06019016	5/14	AAA	B727	JT8D	C	3	3
06059023	5/20	FTLS	DC8	JT3D	F	3	3
06059025	5/23	SOU	DC9	JT8D	T	7	4
06229153	6/22	WAL	B727	JT8D	F	3	3
06279025	6/14	AAL	B727	JT8D	F	3	3
06279031	6/10	RAHT	SD330	PT6	T	2	2
07199025	4/27	SPAT	CV340	501	T	1	5
07239021	7/2	AAA	DC9	JT8D	T	7	3
07249026	7/2	OZA	DC9	JT8D	T	5	5
07319020	7/13	RANT	STC262	PT6A	C	5	4
07319025	7/31	RANT	STC262	PT6A	T	2	4

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>CAUSE</u>	<u>FLIGHT CONDITION</u>
08019018	7/19	NAL	DC10	CF6	T	2	3
08029019	7/18	NAL	DC10	CF6	T	2	4
08139029	7/24	FAL	B737	JT8D	F	3	8
08169020	8/5	CRAT	CV580	501	C	3	3
08179010	8/17	FAL	B737	JT8D	F	3	3
08249024	7/28	BNF	B727	JT8D	C	3	5
08319030	8/13	AAA	DC9	JT8D	C	7	3
09049028	8/17	PAI	B727	JT8D	F	3	3
09149011	8/24	OZA	DC9	JT8D	F	3	3
09179027	8/27	CAL	B727	JT8D	T	7	1
09249057	9/24	AAIX	B720	JT3D	T	7	3
09279030	7/10	RAHT	SD330	PT6A	T	5	2
10029022	8/29	AAIX	B720	JT3C	T	7	3
10099036	9/15	CAL	DC10	CF6	F	3	6
10119039	8/24	AAA	DC9	JT8D	C	3	3
10199037	9/30	UAL	B747	JT9D	F	3	3
10229035	10/2	UAL	B727	JT8D	T	2	5
10239038	10/3	TWA	B707	JT3D	F	3	3

CHARACTERISTICS OF ROTOR FAILURES - 1979

<u>SDR NO.</u>	<u>DATE</u>	<u>SUBMITTER</u>	<u>AIRCRAFT</u>	<u>ENGINE</u>	<u>COMPONENT</u>	<u>CAUSE</u>	<u>FLIGHT CONDITION</u>
10299030	10/12	AAL	B727	JT8D	C	3.	3
11029021	10/16	TIAS	L188	501	C	3	3
11079034	10/23	TWA	B707	JT3D	C	3	4
11029021	11/2	TIAS	L188	501	C	7	3
12069032	11/14	TWA	B727	JT8D	F	3	4
01180034	12/31	NAL	DC10	CF6	F	3	5
01230037	12/26	UAL	DC8	JT3D	F	3	3

DISTRIBUTION LIST

<u>Activity</u>	<u>Copies</u>
Commander, Naval Air Systems Command (AIR-50174), Department of the Navy, Washington, DC 20361	9
<u>Intra-command Addresses:</u>	
AIR-330A (1)	AIR-5361 (1)
AIR-530 (1)	AIR-5362 (1)
AIR-536 (1)	AIR-330 (1)
AIR-5360 (1)	MAT-03L (1)
Commander, Naval Air Development Center, Department of the Navy, Warminster, PA 18974	1
Commanding Officer, Naval Air Engineering Center, Department of the Navy, Lakehurst, NJ 08733	1
Commanding Officer, Naval Aviation Safety Center, Naval Air Station, Norfolk, VA 23511	1
Director, Applied Technology Laboratory, U.S. Army Research and Technology Laboratories, Ft. Eustis, VA 23604	1
Commanding General, U.S. Army Aviation Systems Command (AMSAV-ERP), 12th and Spruce Streets, St. Louis, MO 63166	1
Commander, Air Force Wright-Aeronautical Laboratory (AFSC), Wright-Patterson Air Force Base, Dayton, OH 45433	1
National Aeronautics and Space Administration Lewis Research Center, Attn: R. H. Johns, MS 49-6, 21000 Brookpark Road, Cleveland, OH 44135	12
National Aeronautics and Space Administration (RF, RO(2), RLC), Washington, DC 20546	4
Federal Aviation Administration (RD-723), Washington, DC 20553	1
Defense Documentation Center for Scientific and Technical Information, Building No. 5, Cameron Station, Alexandria, VA 22314	12
Aeroelastic Laboratory, Massachusetts Institute of Technology, Cambridge, MA 02139	4

**DATE
TIME**